


# AltoUpdate...

MAKE	TRANSMISSION	APPLICATION	YEAR
GM	4T65E	2nd Clutch Selective Steel Plate	Various
DESCRIPTION & NOTES...			

## Solve Clutch Pack Clearance Problems... Buick, Chevrolet, Oldsmobile & Pontiac

The GM 4T65E 2nd clutch pack has no provision for clutch pack clearance adjustment. The normal stack-up takes five steels at .068" thick (Alto#062733) and six friction plates at .070" thick (Alto#062722). Historically the 2nd clutch pack has too much clutch pack clearance, by using the 062733-228 that is .090" thick; in combination with OE thickness steel plates the clutch pack can be adjusted.

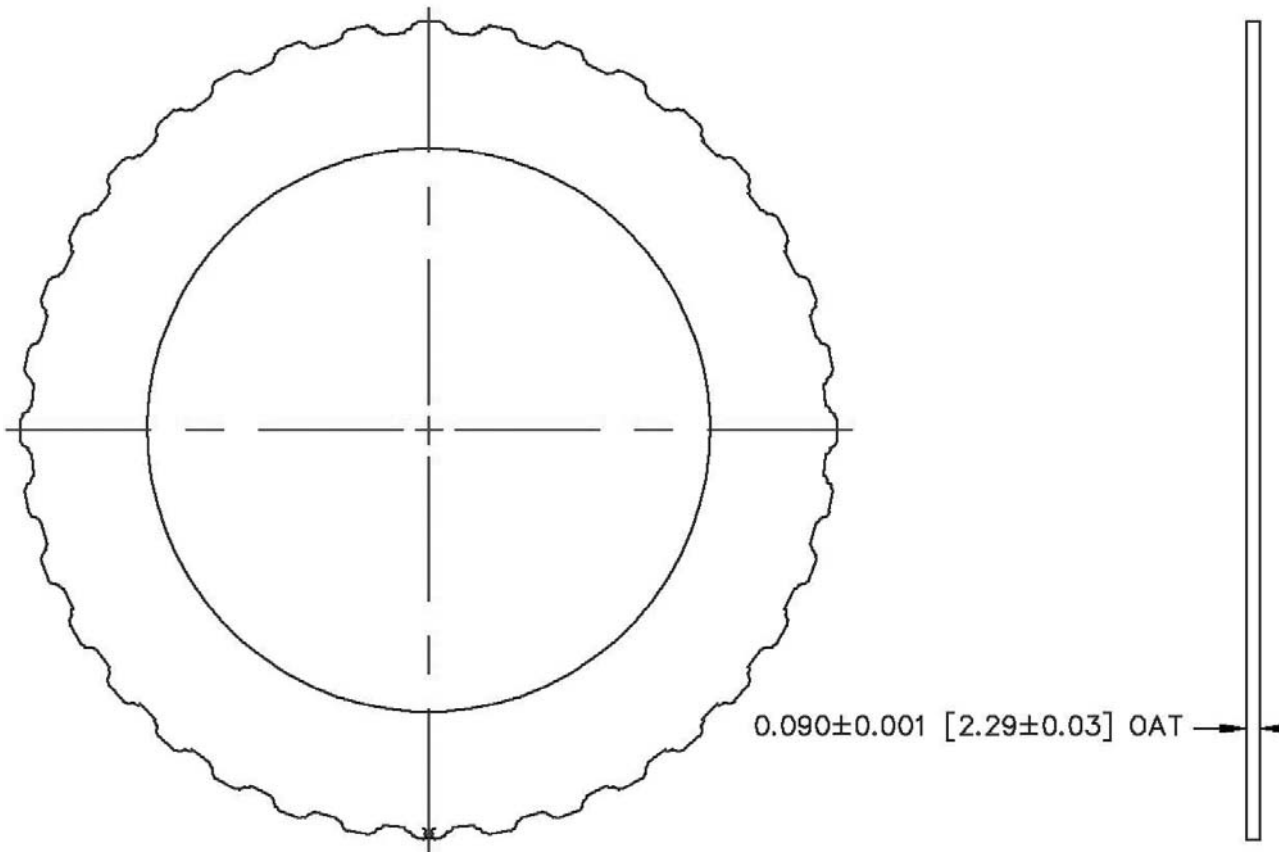

Alto Way • PO Box 1088 • Atmore • AL • 36504  
Tel: 251.368.7777 • Fax: 251.368.7774 • [www.altostandard.com](http://www.altostandard.com)

Clutches and Gears for Automatic and Standard Transmissions

0401003

