

AltoUpdate...

MAKE	TRANSMISSION	APPLICATION	YEAR
GM	TH700-R4	SERVO PIN (MODIFIED)	82-On
DESCRIPTION & NOTES...			


New! Original Equipment Improvement® Servo Pin (Modified) Alto #057301...

Problem:

When rebuilding the 4L60 / 4L60E / 4L65E / 4L70E you may encounter clearance problems with the 2-4 band. Due to drum changes, band changes and case changes there may be too much or too little clearance. GM has three size pins, but the longest may not be long enough.

Solution:

Alto now offers an OEI® Servo Pin (Modified) #057301 that is extra long and hardened. This pin can be ground to length to meet the specification. The new pin also offers new lands to make a better seal between the case and pin. The Alto pin is identified by a small flat spot ground into the strap anchor end.

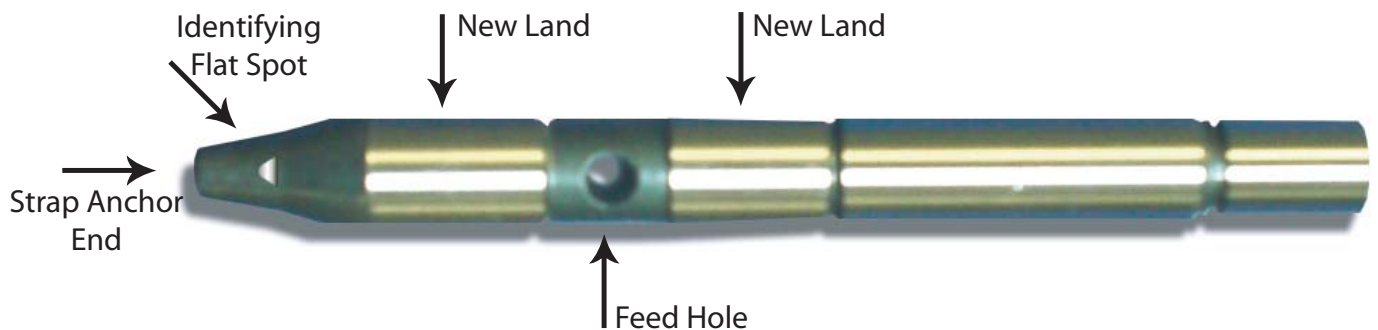

Contact your Alto Sales Representative for more information about or to order Alto Original Equipment Improvement® Servo Pin (Modified) #057301.

Alto Way • PO Box 1088 • Atmore, AL • 36504 • 251.368.7777 • Fax 251.368.7774 • www.altoUSA.com

Clutches and Gears for Automatic and Standard Transmissions

0606001



© Alto Products Corp.