




ALTO PRODUCTS CORP.

073001

New Product Release

E4OD – 4R100 / Overdrive Return Spring Snap Ring
Alto Part # 026269HD

Transmission	Application	Year
E4OD	Ford Bronco	94-96
	Ford Expedition	97-98
	Ford Pickup F-150	92-98
	Ford Pickup F-250	89-97
	Lincoln Navigator	98
4R100	Ford F-250 / F-350 / F-550	99-01
	Ford Expedition	99-01
	Lincoln Navigator	99-01

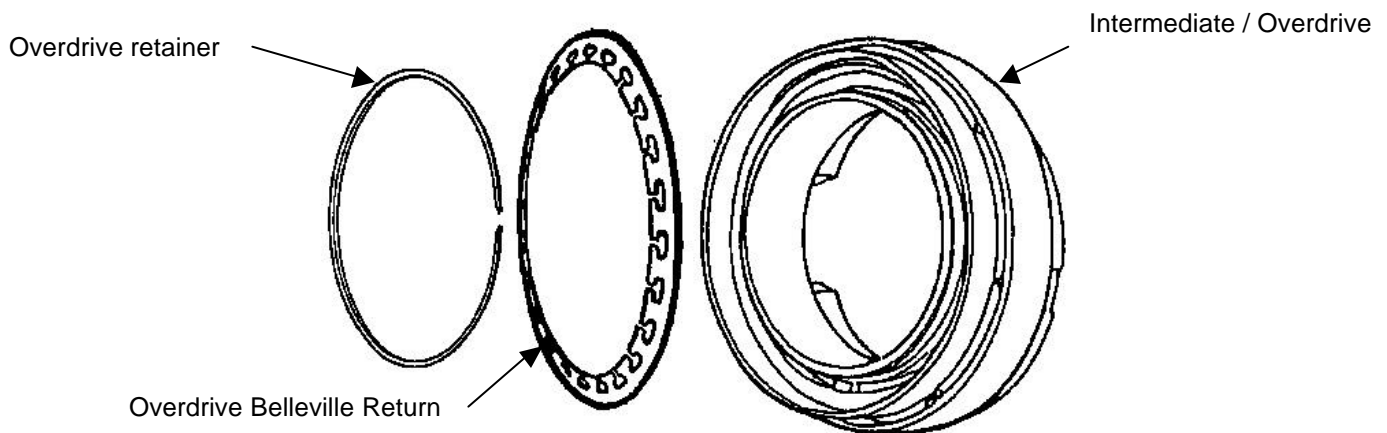

Problem: Harsh 3 – 4 shift, damage to overdrive clutch pack. The snap ring that retains the Belleville return spring in the overdrive clutch will fold or roll out of the snap ring groove. This will give you a harsh 3 – 4 shift. The contributing factor for this failure is the width of the snap ring land. It is too wide, and this allows the snap ring to tip up in the land and eventually roll out of the snap ring groove.

Alto Products Corp. snap ring part number 026269HD is thicker than the improved OE snap ring. This added thickness does not allow the snap ring to tip or roll out of the snap ring land / groove. Be sure to include this valuable updated snap ring in every E4OD / 4R100 rebuild.

Shift... Your Thinking

Alto Way · Atmore · AL · 36504
251.368.7777 · Fax: 251.368.7774

www.altoUSA.com · Email: sales@altoUSA.com