



ALTO PRODUCTS CORP.

081401


New Product Release

**Mitsubishi / Hyundai / Chrysler / Overdrive Clutch PowerPack Kit
With Apply Piston "D" Type Sealing Rings
Alto# Part No. 059935PWR**

Transmission : KM 175 , KM 176, KM 177
F4A21, F4A22, F4A23, W4A32, F4A33, WA433

Contents of kit include: 4 Frictions Plates #059746-150 Red Eagle (.059/1.5mm)
4 Steel Plates #059713K120 Kolene (.047/1.2mm)
1 Seal Kit #059835

Problem: Many reports of premature clutch failure are caused by the fact that the OEM dimension of the steels is too thin to dissipate the heat during clutch engagement. Any heat that is applied to the steels will cause the steels to distort and/or warp and cause premature Overdrive clutch failure. Also, the OEM type apply piston lip seal is extremely difficult to install, causing the lip to fold under and lack of hydraulic pressure to the end clutch.

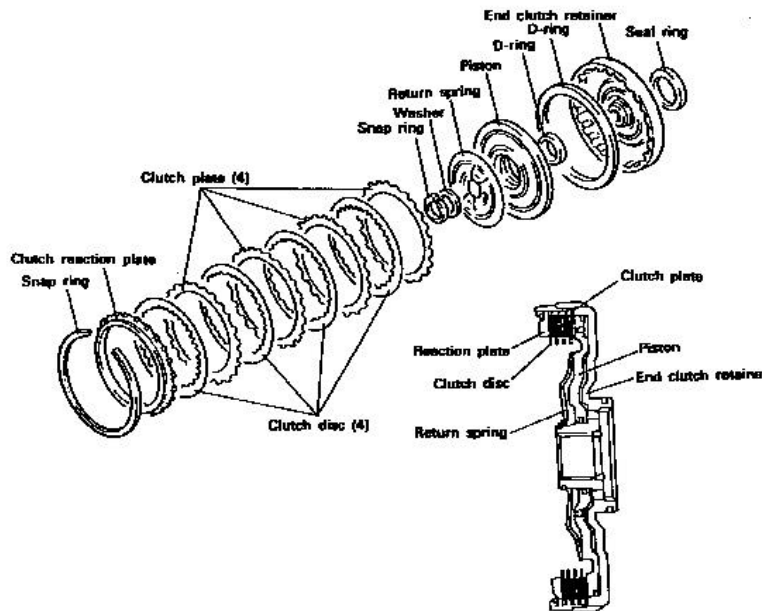

Solution: Alto kit #059935PWR contains all of the components to repair the Overdrive clutch. The steel thickness has been increased by 48%. This will prevent steel plate distortion. The addition of the "D" ring to this kit allows easy installation.

Shift... Your Thinking

Alto Way · Atmore · AL · 36504
251.368.7777 · Fax: 251.368.7774

www.altoUSA.com · Email: sales@altoUSA.com