

AltoUpdate...

MAKE	TRANSMISSION	APPLICATION	YEAR
Mercedes	722.6	Replacement Clutches	Various
DESCRIPTION & NOTES...			


Premature Clutch Failure in the Mercedes 722.6 Resolved with Alto Torque Converter Clutch Plates...

Year/Model: C&E Class '97-On, S&SL Class '96-On, SLK230 '98-On, ML '99-On

Problem: Many reports of premature clutch failure in the torque converter of the Mercedes 722.6.

Solution: Alto #s 141714 friction plate, 141715-177 and 141715-390 steel plates make up the lock-up device in the 722.6 torque converter. Alto has produced these high wear, high torque friction plates in Red Eagle® friction lining.

Torque Converter

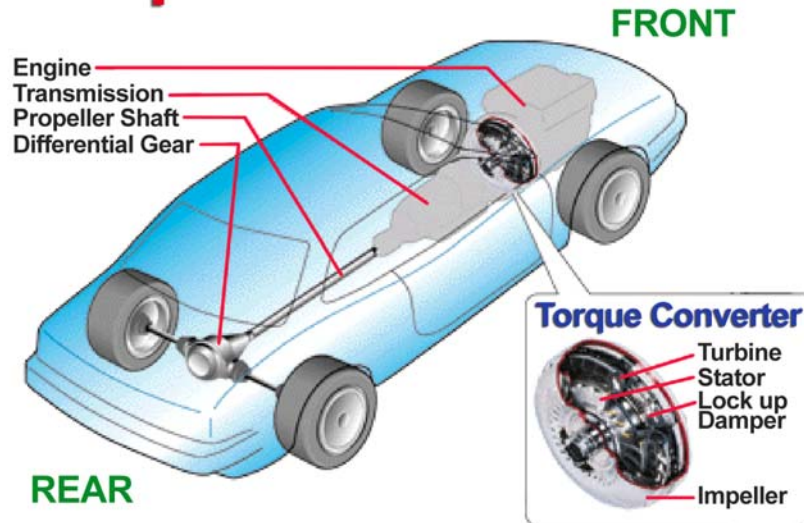

MERCEDES 722.6 CONVERTER STACK-UP

Alto#	Qty	Description	Specs.
141714	2	Red Eagle Frictions	.107"/2.72 mm
141715-177	2	Steel Plates	.069"/1.77 mm
141715-390	1	Steel Plate	.155"/3.9 mm

Alto Way • PO Box 1088 • Atmore • AL • 36504
 Tel: 251.368.7777 • Fax: 251.368.7774 • www.altoUSA.com

Clutches and Gears for Automatic and Standard Transmissions

0402004

