

AltoUpdate...

MAKE	TRANSMISSION	APPLICATION	YEAR
Allison	540 Series	3rd Clutch CaseSaver™	'70-On
DESCRIPTION & NOTES...			

New Allison 540 Series CaseSaver™ Alto #055758...


DURABILITY AND PERFORMANCE BENEFITS

Allison transmissions have encountered a problem with the 3rd clutch steel plates "knocking" into the case lugs. This introduces large quantities of aluminum into the hydraulic system and can also cause delayed engagement.

Alto Products Corp. is the only aftermarket manufacturer to offer a CaseSaver™ kit for this problem. The spring steel clips fit into the damaged case, providing a smooth hard surface for the special modified steel plate to fit. The teeth of the friction clutch have also been hardened to help prevent wear. By using this Alto CaseSaver™ kit, you can reduce your costs by salvaging a previously worn and/or unusable case.

Alto Kit #055758

ALTO #	QTY	DESCRIPTION
055300	9	3rd Range Case Saver Clips
055704B250	3	3rd Range Hardened Spline Friction Plates
055705A255	3	3rd Range Modified Steel Plates

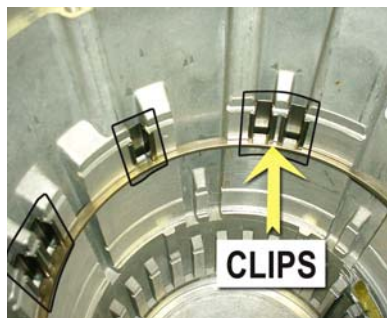

INSTALLATION

The stack-up of the transmission clutch pack is the same method as OE. Prep the case by removing any damaged area that will prevent installation of the CaseSaver clips. Install the 9 clips, proceed with normal installation of the steel and friction plates.

Alto Way • PO Box 1088 • Atmore • AL • 36504
 Tel: 251.368.7777 • Fax: 251.368.7774 • www.altoUSA.com

Clutches and Gears for Automatic and Standard Transmissions

0505003

